

I-193596


SCHRADER'S HONDA YAMAHA
P.O. BOX 1986
HIGHWAY 9 NORTH
YORKTON, SK S3N 3X3
Phone: 306-783-3333

Repair Order Invoice

Doc Number: 29395
Service Writer: CHARLENE ZULYNIAK
Date Printed: 04/14/2025
Date Promised: 07/13/2021
Cashier: CHARLENE ZULYNIAK
Cashier Date: 08/25/2021

Customer Information

Home Phone: 306-594-7644

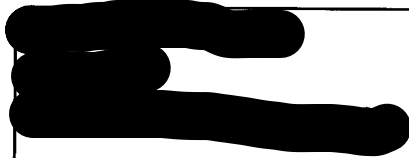

Summary

Approve	Decline	Unit	Job	Job Total
<input checked="" type="checkbox"/>	<input type="checkbox"/>	2005 YAMAHA YFM66FAT	CHECK ELECTRIC START	\$725.10
<input checked="" type="checkbox"/>	<input type="checkbox"/>	2005 YAMAHA YFM66FAT	ATV OIL CHANGE AND GENERAL INSPECTION.	\$102.31
<input checked="" type="checkbox"/>	<input type="checkbox"/>	2005 YAMAHA YFM66FAT	CHECK NOISE IN REWIND	\$71.91
<input checked="" type="checkbox"/>	<input type="checkbox"/>	2005 YAMAHA YFM66FAT	ATV/SIDE BY SIDE WHEEL BEARING REPLACEMENT	\$374.74
<input checked="" type="checkbox"/>	<input type="checkbox"/>	2005 YAMAHA YFM66FAT	CHECK BRAKES	\$207.61
<input checked="" type="checkbox"/>	<input type="checkbox"/>	2005 YAMAHA YFM66FAT	YAMAHA ATV CLUTCH SERVICE	\$1,037.33
<input checked="" type="checkbox"/>	<input type="checkbox"/>	2005 YAMAHA YFM66FAT	CARB JOB	\$138.74
Job Subtotal:				\$2,657.74
Misc:				\$22.61
Job Parts Subtotal:				\$1,789.04
Job Labor Subtotal:				\$868.70
PST - 6.00%:				\$160.81
GST - 5.00%:				\$134.03
Total:				\$2,975.19
Less Deposits:				\$0.00
3Mastercard:				(\$2,975.19)
Total Due:				\$0.00

Thank You For Your Business!

NO RETURNS ON ELECTRICAL PARTS!
GST # R104746193

CASH, VISA, MASTERCARD OR AMERICAN EXPRESS

Signature: _____

Detail

Unit 2005 YAMAHA YFM66FAT Grizzly 660 Auto
4x4

Color:

Keyboard:

VIN/Serial No:JY4AM03W45C027893

Plate:

Odom/Hrs In:6,375

Out:6,382

CHECK ELECTRIC START

Description:CHECKED CHARGING SYSTEM...UNIT NOT CHARGING

Resolution:REMOVED PANELS , FOOTREST ETC TO ACCESS STATOR COVER, DRAINED ENGINE OIL AND REMOVED COVERS ,
REMOVED AND REPLACED STATOR ASSEMBLY, RE-ASSEMBLED AND FILLED WITH OIL, CHANGED FILTER, TOPPED UP
COOLANT AND BLED COOLING SYSTEM...TESTED OUTPUT, UNIT CHARGING GOOD

Parts

Part #	Qty	Description	Price	Discount	Total
5KM-81410-01-00	1.00	STATOR ASSY	\$519.13	(\$51.91)	\$467.22
5KM-15451-00-00	1.00	GASKET, CRANKCASE	\$13.66	\$0.00	\$13.66
93210-21190-00	1.00	O-RING	\$6.22	\$0.00	\$6.22
Parts Subtotal					\$487.10

Labor

Description	Technician	Hours	Total
	MILES PEARCE	2	\$238.00
Labor Subtotal			\$238.00

Job Subtotal **\$725.10**

Approve: ☒ **Decline:** ☐

ATV OIL CHANGE AND GENERAL INSPECTION.

Description:TECHNICIAN BROUGHT IN UNIT, DRAINED AND CHANGED ENGINE OIL AND FILTER. CHECK FRONT AND REAR DIFFERENTIAL
OIL CONDITION AND LEVEL. INSPECT AIR FILTER AND AIR BOX. CHECK FRONT AND REAR (IF APPLICABLE) CV BOOTS ,
WHEEL AND AXLE BEARINGS. CHECK AND SET TIRE AIR PRESSURES AND OPERATION OF ALL CONTROLS.

Resolution:ENG OIL AND FILTER CHANGED WITH STATOR, DRAINED AND CHANGED FRONT AND REAR DIFF OILS, CHECKED OVER UNIT,
CLEANED AND SERVICED...RE-OILED AIR FILTER.

Recommend:UNIT NEEDS BRAKES ALL AROUND,
NEEDS ALL 4 WHEEL BEARINGS...ALL BAD

Parts

Part #	Qty	Description	Price	Discount	Total
5GH-13440-61-00	1.00	ELEMENT OIL FILTER	\$21.97	\$0.00	\$21.97
OILBULK20W50	2.10	20W50 YAMALUBE BULK OIL	\$8.10	\$0.00	\$17.01
OILBULK80W90GEAR	0.45	80W90 HYPOID GEAR OIL 1 LITRE	\$8.50	\$0.00	\$3.83
Parts Subtotal					\$42.81

Labor

Description	Technician	Hours	Total
	MILES PEARCE	0.5	\$59.50
Labor Subtotal			\$59.50

Job Subtotal **\$102.31**

Approve: ☒ **Decline:** ☐

CHECK NOISE IN REWIND

Description:REMOVED REWIND FOR INSPECTION, NEEDS NEW SPRING AND ROPE

Resolution:REMOVED REWIND, CLEANED AND INSTALLED NEW SPRING AND ROPE, REASSEMBLED AND TESTED .

Parts

Part #	Qty	Description	Price	Discount	Total
5UH-15713-00-00	1.00	SPRING, STARTER	\$22.02	(\$2.20)	\$19.82
8CH-15751-00-00	1.00	WIRE STARTER	\$24.82	(\$2.48)	\$22.34
Parts Subtotal					\$42.16

Labor

Description	Technician	Hours	Total
	MILES PEARCE	0.25	\$29.75
Labor Subtotal			\$29.75

Job Subtotal **\$71.91**

Approve: ☒ **Decline:** ☐

ATV/SIDE BY SIDE WHEEL BEARING REPLACEMENT

Description: TECHNICIAN BROUGHT IN UNIT, REMOVED WHEEL, HUB AND BRAKE ASSEMBLY. DISCONNECT UPPER AND LOWER A-ARMS FROM SPINDLE AND REMOVED SPINDLE. REPLACE WHEEL BEARINGS AND SEALS AS REQUIRED, CHECK BRAKE CONDITION AND ADVISE. RE-ASSEMBLE AS REQUIRED.

Resolution: CHANGED ALL 4 WHEEL BEARINGS.

Parts

Part #	Qty	Description	Price	Discount	Total
17S-WB024-00-00	2.00	KIT ATV WHEEL BEAR	\$90.95	(\$9.09)	\$163.72
90105-10480-00	2.00	BOLT, WASHER BASED	\$8.58	\$0.00	\$17.16
90185-10060-00	2.00	NUT, SELF-LOCKING	\$7.68	\$0.00	\$15.36
Parts Subtotal					\$196.24

Labor

Description	Technician	Hours	Total
WHEEL BEARING REPLACEMENT	MILES PEARCE	1.5	\$178.50
Labor Subtotal			\$178.50

Job Subtotal **\$374.74**

Approve: ☒ Decline: ☐

CHECK BRAKES

Description: UNIT NEEDS BRAKES ALL AROUND, REPLACE AS REQUIRED

Resolution: CHANGED ALL FRT AND REAR BRAKE PADS, FREED UP AND CLEANED CALIPERS, BLED BRAKES, WORK AS THEY SHOULD

Parts

Part #	Qty	Description	Price	Discount	Total
SBS592SI	1.00	BRAKE PAD (VD1272/DP811)	\$35.95	(\$3.59)	\$32.36
SBS799SI	1.00	YAMAHA YFM660 GRIZZLY 02	\$41.95	(\$4.19)	\$37.76
007358	1.00	FA84R EBC BRAKE PAD FT/RR	\$46.99	(\$4.70)	\$42.29
Parts Subtotal					\$112.41

Labor

Description	Technician	Hours	Total
	MILES PEARCE	0.8	\$95.20
Labor Subtotal			\$95.20

Job Subtotal **\$207.61**

Approve: ☒ Decline: ☐

YAMAHA ATV CLUTCH SERVICE

Description: TECHNICIAN BROUGHT IN UNIT, REMOVED RHS FOOT REST TO ACCESS CLUTCH COVER, REMOVED COVER AND PRIMARY CLUTCH. DISASSEMBLED., CLEANED, GREASED AND RE-ASSEMBLED WITH NEW PART IF REQUIRED. INSPECT DRIVE BELT AND SECONDARY CLUTCH. CLEANED CLUTCH HOUSING AND RE-ASSEMBLED AND TESTED.

Resolution: REMOVED FOTTWELL, COVERS ETC TO ACCESS CLUTCHES, REMOVED PRIMARY AND DIS-ASSEMBLED, CLEANED OLD CRUSTY GREASE AND CLEANED PARTS, CLUTCH IN BAD SHAPE, NEDDS NEW WEIGHTS..ROLLERS, SLIDING SHIEVE, WEIGHT CAM ETC, INSTALLED NEW GREASE AND RE-ASSEMBLED, INSTALLED NEW DRIVE BELT AND TESTED, CLUTCH WORKS AS IT SHOULD

Parts

Part #	Qty	Description	Price	Discount	Total
ACC-ULTRG-RE-AS	0.30	LUB ULTRAMATIC GRE	\$41.95	\$0.00	\$12.59
5KM-17641-01-00	1.00	V-BELT	\$213.00	(\$21.30)	\$191.70
5KM-17620-00-00	1.00	PRIMARY SLIDING SH	\$404.90	(\$40.49)	\$364.41
93101-35001-00	2.00	OIL SEAL	\$22.58	\$0.00	\$45.16
5KM-17632-00-00	8.00	WEIGHT	\$12.42	(\$1.24)	\$89.44
5KM-17623-00-00	1.00	CAM	\$72.10	(\$7.21)	\$64.89
4WV-17654-01-00	4.00	SPACER 1	\$6.04	\$0.00	\$24.16
4WV-17653-00-00	4.00	SLIDER	\$9.78	\$0.00	\$39.12
93211-594A4-00	1.00	O-RING	\$27.36	\$0.00	\$27.36
Parts Subtotal					\$858.83

Labor

Description	Technician	Hours	Total
CLUTCH CLEAN AND INSPECT	MILES PEARCE	1.5	\$178.50
Labor Subtotal			\$178.50

Job Subtotal **\$1,037.33**

Approve: ☒ Decline: ☐

CARB JOB**Description:**UNIT RUNS ON CHOKE ONLY...INSPECT**Resolution:**removed carb and dis-assembled to inspect, carb jets plugged up and corrosion in bowl. float valve worn out and needle jet dis-assembled and cleaned , installed kit and re-assembled, run up and unit runs well**Parts**

Part #	Qty	Description	Price	Discount	Total
237261407	1.00	CARBURETOR REBUILD KIT YAMAHA	\$54.99	(\$5.50)	\$49.49
Parts Subtotal					\$49.49

Labor

Description	Technician	Hours	Total
	MILES PEARCE	0.75	\$89.25
Labor Subtotal			\$89.25

Job Subtotal **\$138.74****Approve:** ☒ **Decline:** ☐

All Jobs Subtotal:	\$2,657.74
Shop Supplies:	\$22.61
PST - 6.00%:	\$160.81
GST - 5.00%:	\$134.03
Total:	\$2,975.19
Less Deposits:	\$0.00
3Mastercard:	(\$2,975.19)
Total Due:	\$0.00